

Repair Order Detail - Internal Copy

RO Number: 728616

RO Status: CLOSED

Customer: H & B OILFIELD SERVICES

Phone(s): Contact: (403)820-1305

Main: (403)998-9022

[Click to View Cust Copy](#)

Vehicle: 1FUJA6CK38LZ79887

2008 COLUM

HB156

Cell:

Mileage: 1,015,210

Payment type: 6C

Waiter: No

Service advisor: 1297

Promised time: 05:00 PM

Estimate: 0.00

Tag number: T3200

Promised date: 11/21/2019

Customer Comments: No

~~~~~  
A      PERFORM COMMERCIAL VEHICLE INSPECTION ON TRUCK/TRACTOR - FULL  
INSPECTION - WHEELS/DRUMS REMOVED - TANDEM DRIVE AXLE

|        |    |                       |      |        |
|--------|----|-----------------------|------|--------|
| M-83-2 | CP | PERFORM COMMERCIAL    | 5.50 | 500.00 |
|        |    | VEHICLE INSPECTION ON |      |        |
|        |    | TRUCK/TRACTOR - FULL  |      |        |
|        |    | INSPECTION -          |      |        |
|        |    | WHEELS/DRUMS REMOVED  |      |        |
|        |    | - TANDEM DRIVE AXLE   |      |        |

Tech(s): 910, 1394

Pts: 0.00 Lbr: 500.00 Other: 0.00 Total Line A: 500.00  
Story: 1015210 GREASED CLUTCH AND DRIVE LINE.

~~~~~  
B** BRAKES, AIR/HYDRAULIC, REPAIR

M-69-4	CP	REPLACE FRONT WHEEL	3.00	432.00
		BEARINGS WITH NEW		
		SEALS, REPAIR AIR		
		LEAKS, REPLACE AIR		
		LINE FROM ABS VALVE		
		TO AXLE #1 RIGHT		
		BRAKE POT		

Tech(s): 910

ZCP3828036	2 SEAL SET	99.36
SH550027745	1 SPIRAX S	12.77
OIL1L	1 OIL ENVIRO 1 LITRE JUG	0.10
TMSET406	1 BEARING SET	32.78
ZCP3303024	1 GASKET-H	2.25
TMSET413	1 BEARING SET	47.67
FARPC14698D	1 90ELB DO	14.23
1775013	3 NYLON TUBIG 1/2"	4.20
FAR146810C	2 AB CONN	15.56
FARX124C	1 45 ELB 3	4.18
FAR110CA	1 BUSHING	2.76
FAR14714A	1 AB TEE 1	6.10
FAR1298	1 SPLICER	3.54

Pts: 245.40 Lbr: 432.00 Other: 0.10 Total Line B: 677.50
Story: 1015210 REPLACED AIR LINE FROM ABS VALVE TO #1 RIGHT
BRAKE POT. REMOVED THE FRONT WHEEL BEARINGS. CLEANED AND
INSPECTED THE PARTS. REPLACED THE FRONT WHEEL BEARINGS AND
ADJUST. REPAIRED SEVERAL AIR LEAKS WITH CONNECTORS.

~~~~~  
C\*\*      EXHAUST, REPAIRS

|        |    |                    |      |       |
|--------|----|--------------------|------|-------|
| M-69-7 | CP | REPAIR EXHAUST AND | 0.50 | 69.95 |
|        |    | INSTALL TWO NEED   |      |       |
|        |    | EXHAUST CLAMPS     |      |       |

Tech(s): 910

# Repair Order Detail - Internal Copy

RO Number: 728616

RO Status: CLOSED

Customer: H &amp; B OILFIELD SERVICES

[Click to View Cust Copy](#)

Phone(s): Contact: (403)820-1305

Main: (403)998-9022

Cell:

Vehicle: 1FUJA6CK38LZ79887

2008 COLUM

HB156

Mileage: 1,015,210

Payment type: 6C

Waiter: No

Service advisor: 1297

Promised time: 05:00 PM

Estimate: 0.00

Tag number: T3200

Promised date: 11/21/2019

Customer Comments: No

|            |                                     |       |
|------------|-------------------------------------|-------|
| FLT50EST   | 1 CLAMP, 5" HD, FLAT,<br>STAINLESS, | 15.31 |
| DONX007785 | 1 SEALCLAM                          | 15.20 |
| FLT12      | 1 \$1 FILTER ENVIRO FEE             | 1.00  |
| FLT0       | 1 NO ENVIRO FEE ON AIR<br>FILTERS   | -1.00 |

Pts: 30.51 Lbr: 69.95 Other: 0.00 Total Line C: 100.46

Story: 1015210 REPAIRED THE EXHAUST AND INSTALLED TWO NEW CLAMPS

## D\*\* DIAGNOSE CHECK ENGINE LIGHT

|         |     |                                          |      |       |
|---------|-----|------------------------------------------|------|-------|
| M-69-12 | CPE | DIAGNOSTIC CODE<br>CHECK, TOP UP COOLANT | 0.50 | 79.95 |
|---------|-----|------------------------------------------|------|-------|

Tech(s): 910

Pts: 0.00 Lbr: 79.95 Other: 0.00 Total Line D: 79.95

Story: 1015210 LINKED TO THE UNIT AND FOUND CODES FOR LOW  
COOLANT. TOPPED UP THE COOLANT AND RECHECKED FOR FAULTS, ALL  
GOOD.

## E\*\* CLUTCH, REPAIR OR ADJUST

|         |    |                                                          |      |        |
|---------|----|----------------------------------------------------------|------|--------|
| M-69-11 | CP | REPAIR & MODIFY<br>LINKAGE, LUBRICATE &<br>ADJUST CLUTCH | 1.00 | 144.00 |
|---------|----|----------------------------------------------------------|------|--------|

Tech(s): 910

Pts: 0.00 Lbr: 144.00 Other: 0.00 Total Line E: 144.00

Story: 1015210 THE CLUTCH LINKAGE WAS SEIZED AND THE PIVOT  
BUSHINGS WERE WORN OUT. REMOVED THE LINKAGE. MODIFIED AND  
REPAIRED THE LINKAGE. REINSTALLED THE LINKAGE. ADJUSTED AND  
LUBRICATED THE CLUTCH

## F\*\* MISC REPAIRS

|      |    |                                                        |      |       |
|------|----|--------------------------------------------------------|------|-------|
| M-69 | CP | LUBRICATE & ADJUST<br>5TH WHEEL, GREASE THE<br>CHASSIS | 0.50 | 72.00 |
|------|----|--------------------------------------------------------|------|-------|

Tech(s): 910

|             |            |      |
|-------------|------------|------|
| SH550027558 | 1 GADUS S3 | 3.15 |
|-------------|------------|------|

Pts: 3.15 Lbr: 72.00 Other: 0.00 Total Line F: 75.15

Story: 1015210 LUBRICATED AND ADJUSTED THE FIFTH WHEEL. GREASED  
THE CHASSIS.

Customer Pay

Labor

1,297.90

Parts

279.06

Lube

0.00

# Repair Order Detail - Internal Copy

|                           |          |
|---------------------------|----------|
| Sublet                    | 0.00     |
| Miscellaneous/Shop Charge | 42.08    |
| Deductible                | 0.00     |
| Total Charges             | 1,619.04 |
| Less Insurance/Adjustment | 0.00     |
| Sales Tax                 | 80.96    |
| Total                     | 1,700.00 |