


212

COMPLETE

TRUCK & TRAILER REPAIR INC.

7220-68 Ave
Edmonton AB, T6B 0A1
Phone: 587-754-6761
GST # 839305067

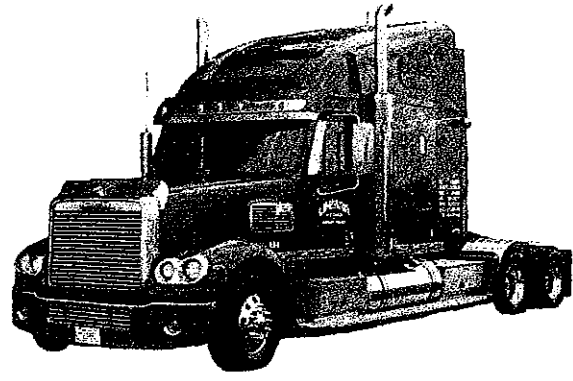

NAME	[REDACTED]
ADDRESS	[REDACTED]
PHONE NUMBER	[REDACTED]

DATE	MARCH 14/19
INVOICE NO	M1164
PO NO.	

MAKE	MODEL	YEAR	SERIAL NO.	ODOMETER
INTERNATIONAL	9800	1997	1HSRSAHR2VH439582	150359
UNIT NO.	ENGINE SERIAL NO.	ENGINE HRS	LICENCE PLATE NO.	

ALL WHEELS REMOVED REQUIRED RETORQUE

Commercial Vehicle Inspection \$250.00

JOB

INSPECTED UNIT.
 REMOVED AND REPLACED DOCK STOPS.
 REPLACED WIPER BLADES.
 REPLACED SUSPENSION LEVELING VALVE ROD BUSHINGS.
 TIGHTENED LOOSE HEATER HOSE CLAMPS, TOPPED UP COOLANT AND CHECKED FOR LEAKS.
 REMOVED #2 AXLE SHOCKS AND LOWER MOUNTS. INSTALLED NEW MOUNTS AND REPLACED BOTH SHOCKS.
 REMOVED AND REPLACED REVERSE SWITCH AND TESTED REVERSE LIGHTS.
 REPLACED L/H CONVEX MIRROR.
 REPAIRED WIRING AT R/H SIGNAL LIGHT.
 REMOVED AND REPLACED L/H STEER HUB, GASKET AND FILLED WITH OIL.
 TIGHTENED LOOSE EXHAUST CLAMP AND U-BOLT AT BOTTOM OF STACK.
 REMOVED FAN BLADE AND FAN HUB. REBUILT FAN HUB, REASSEMBLED AND TESTED.
 REMOVED DRIVESHAFT AND FRONT DIFF POWER DIVIDER. REPLACED O-RINGS AND REASSEMBLED.
 REMOVED AND REPLACED SEAT AIR SWITCH.
 CHECKED ALL FLUID LEVELS.
 ADJUSTED CLUTCH TO SPEC.

TOTAL HOURS	12.00
TOTAL LABOUR	\$1,798.00

