

248-1:2



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 85398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 01/22/2024 5:00 PM

Cashiered 04/09/2024 2:34 PM

Printed 04/09/2024 2:35:04 PM

PO #

Service Invoice INTERNAL COPY

Page 1

Tag

SO # 809338

Customer No Attn: EDMONTON TRAILER SALES GP 10602-82 AVENUE CLAIRMONT, AB T8X 5G9 GST: NoTaxNumber Home Bus (780) 830-3063 Cell Today Email	Advisor Taylor Invoice Date: 04/09/2024 2:34 PM Term CASH License No 1 Odometer In 1 Odometer Out 1 Delivery Date Stock No 14948A Year 2015 Make EXOSENT Model EXO LPG - SUPER B Model No Colour Vehicle ID No 1E9X6SB21FC519105 Selling Dealer SO Date 01/22/2024 InServ Date Location Engine Size Fleet # PIC/AD
--	---

Request	Description	Job	CSR	Status
CVIP-	COMMERCIAL VEHICLE INSPECTION 14948A	1	TAYLOR	Original
Labour	Description	Type	Tech	Amount
CVIP-	- Perform Commercial Vehicle Inspection - Record deficiencies - Fill out appropriate paperwork - Decal unit - CV7623043	I-ADV	GP TECH	300.00
Labour Total				300.00
Request Total				300.00

Request	Description	Job	CSR	Status
CVIP	REPAIRS FOR CVIP	2	KAYLEIGH	Approved
Labour	Description	Type	Tech	Amount
CVIP	- Sniff unit = safe - Remove rear hatch - Take off caps from plumbing - Bring unit inside - Sniff after warmed up = Hot - Take unit outside to air out - Sniff unit = Safe - Move Unit into Shop - Put unit on axle stands and remove wheels - Remove axle #2 L/H & R/H shocks - Remove axle #2 L/H & R/H bottom airbag bolts - Remove axle #2 R/H brake chamber - Remove axle #2 R/H caliper and hub/rotor assembly - Remove axle #2 both pivot bolts - Drop and Remove axle #2 - Prep New axle for tiremaax system - Measure and mark new holes and drill out holes for tiremaax system - Install Tiremaax system into axle - Remove airbag mounts from old axle - Install airbag mounts on to new axle - Slide new axle into position and lift into place - Install new tri-functional bushings and wear pads - Prep R/H and L/H wheel ends for installs - Re-install all components removed off old axle - Clean and repack axle #2 R/H bearings in hub - Remove and replace axle #2 R/H wheel seal - Install new hub/rotor assembly onto axle #2 R/H - Set bearings	I-ADV	GP TECH	4,200.00

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6


* No Refunds or Exchange on Parts after 30 days.

* No Refunds or Exchange on Electrical Items or Special Orders.

* Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____

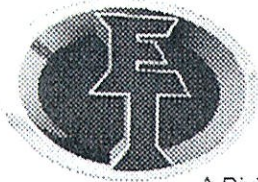

ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 89398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 01/22/2024 5:00 PM

Cashiered 04/09/2024 2:34 PM

Printed 04/09/2024 2:35:04 PM

PO #

Service Invoice INTERNAL COPY

Page 2

Tag

SO # 809338

Customer No

Attn:

EDMONTON TRAILER SALES GP

10602-82 AVENUE

CLAIRMONT, AB T8X 5G9

GST: NoTaxNumber

Home

Bus (780) 830-3063

Cell

Today

Email

Advisor Taylor

Invoice Date: 04/09/2024 2:34 PM Term CASH

License No	Odometer In	Odometer Out	Delivery Date	Stock No
	1	1		14948A
Year	Make	Model	Model No	Colour
2015	EXOSENT	EXO LPG - SUPER B		
Vehicle ID No	Selling Dealer	SO Date	InServ Date	Location
1E9X6SB21FC519105		01/22/2024		
Engine Size	Fleet #	PIC/AD		

- Repack axle #2 R/H bearings in hub
- Remove and replace axle #2 R/H wheel seal
- Install hub/rotor assembly onto axle #2 R/H
- Set bearings
- Install new brake pads and caliper on axle #2 R/H
- Install new brake chamber axle #2 R/H
- Remove and replace brake pads on axle #3 R/H
- Install new hubcap and gasket
- Remove and Clean axle #3 R/H hub assembly
- Re-pack bearings and set
- Remove and replace axle #3 R/H wheel seal
- Re-install axle #3 R/H hub assembly
- Remove and replace axle #3 R/H rotor
- Remove and rebuild axle #3 R/H caliper
- Re-install axle #3 R/H caliper
- Remove and rebuild axle #1 L/H & R/H calipers
- Remove and replace all hubcap gaskets & hub oils
- Replace axle #2 L/H & R/H tires
- Replace axle #2 R/H rims
- Install tires
- Install/Re-install tiremax lines
- Perform Alignment
- Diagnose Abs issue
- Remove axle #1 L/H & R/H wheels
- Set Tone ring on axle #1 R/H
- Remove and replace axle #1 L/H & R/H wheel speed sensors
- Re-install wheels
- Grease unit
- Remove axle stands
- Torque wheels and tag
- Set up brakes
- Install rear tank hatch
- Move unit out of bay
- Clean bay

Sublet

87853.1

87873.3

Part

SSP1777

NPN

Description

KAB2-3/KAL TIRE/87853 TIRE MOUNT ON RIM X4

RINECORP LIM1/RINECORP LIMITED /87873 EXOSENT CVIP REPAIRS - 9338

Description

AIR DISC PADS, WABCO PAN22

87729 HTRAAX BRAKE DISK BRAKE HTRAAX. 7814

Shp

Bin

Type

CSR

Amount

ISUB-ADV TAYLOR 249.23

ISUB-ADV TAYLOR 480.00

I-ADV 141.11 282.22

I-ADV 3,731.75 3,731.75

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

* No Refunds or Exchange on Parts after 30 days.

* No Refunds or Exchange on Electrical Items or Special Orders.

* Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 89398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 01/22/2024 5:00 PM

Cashiered 04/09/2024 2:34 PM

Printed 04/09/2024 2:35:04 PM

PO #

Service Invoice

Page 3

Tag

SO # 809338

Customer No

Advisor Taylor

Invoice Date: 04/09/2024 2:34 PM Term CASH

Attn:

EDMONTON TRAILER SALES GP

10602-82 AVENUE

CLAIRMONT, AB T8X 5G9

GST: NoTaxNumber

Home

Bus (780) 830-3063

Cell

Today

Email

License No	Odometer In	Odometer Out	Delivery Date	Stock No
	1	1		14948A
Year	Make	Model	Model No	Colour
2015	EXOSANT	EXO LPG - SUPER B		
Vehicle ID No	Selling Dealer	SO Date	InServ Date	Location
1E9X6SB21FC519105		01/22/2024		
Engine Size	Fleet #	PIC/AD		

NPN	87729 TMAAX KIT-AXLES (AFTERMARKET) VS-9201TM	1	ISO	I-ADV	143.69	143.69
NPN	87797 ROTOR, AIR DISC, PAN 22, SSR941	1	ISO	I-ADV	295.32	295.32
6402250800	CALIPER DISC BRAKE	1	ISO	I-ADV	1,114.24	1,114.24
10083398	PRESET HUB/ROTOR ASSY, ALUM	1	ISO	I-ADV	1,883.70	1,883.70
6000	CAP NUT - Flanged	10	ISO	I-ADV	2.42	24.20
S285001657	Dust Shield, Cw Clamp, 5 3/4"	1	US-F2	I-ADV	46.52	46.52
NPN	87797 BRAKE CHAMBER, GOLD SEAL, AIR DISC, 2.25" STROKE GC2024D	1	ISO	I-ADV	211.49	211.49
S33649-2	AIR DISK ATTACHMENT HARDWARE	5	I3	I-ADV	22.90	114.50
NPN	87797 HP GREASE DUAL TMX PRO HUBCAP VS320563	1	ISO	I-ADV	175.38	175.38
803114	GUIDE PIN KIT - ADB22X	1	H2	I-ADV	332.15	332.15
NPN	87847 WHEEL, ALUM, 34.5X8.25, POLISHED IN/OUT FTAW245P	4	ISO	I-ADV	313.84	1,255.36
3727099	WHEEL SEAL - 2023 (307-0723)	2	I1	I-ADV	51.35	102.70
1485-4	AIR LINE = 1/4", Black, Synflex	4	T4	I-ADV	0.29	1.16
75W90 GEAR OIL	OIL - Gear, Synthetic, 75W90	3	SHOP	I-ADV	11.69	35.07
3303118	GASKET - Hubcap	4	G END	I-ADV	1.54	6.16
IMT-6402259212	REPAIR KIT, WABCO PAN 22	3	I4	I-ADV	138.06	414.18
NPN	87852 ROTOR, AIR DISC, PAN 22 SSR948	1	ISO	I-ADV	304.69	304.69
PAR VS68NTA-4-2	14684A CONNECTOR - (Male) - 1/4" Tube x 1/8" NPT	1	BIN 4C	I-ADV	1.07	1.07
PAR 62NTA-6	14626 UNION - 3/8"	1	BIN 3A	I-ADV	2.40	2.40
3303118	GASKET - Hubcap	2	G END	I-ADV	1.54	3.08
3727099	WHEEL SEAL - 2023 (307-0723)	2	I1	I-ADV	51.35	102.70
NPN	87797 ROTOR, AIR DISC, PAN 22, SSR941	-1	ISO	I-ADV	295.32	-295.32
VS337672	AUTO INFLATION AIR LINE (STRAIGHT)	3	H2	I-ADV	44.51	133.53
VS337692	AUTO AIR LINE 90	2	H2	I-ADV	41.06	82.12
13-3057	LOW PRO M22 WHEEL NUT, 26MM	20	H3	I-ADV	4.79	95.80
NPN	87854 ROTOR, ASIR DISC, PAN 22 W/ BOLT KIT SSR948	1	ISO	I-ADV	304.69	304.69
R955337	ABS SENSOR - (Hyd), 1.8m	2	A5	I-ADV	69.00	138.00
PAR 68RBSG-6-6	14936C SPRING CONNECTOR - Male, 3/8" x 3/8"	2	BIN 3C	I-ADV	7.81	15.62
1485-6	AIR LINE - 3/8", Black, Synflex	6	T4	I-ADV	0.65	3.90

Parts Total 11,062.07
Labour Total 4,929.23
Request Total 15,991.30

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

* No Refunds or Exchange on Parts after 30 days.

* No Refunds or Exchange on Electrical Items or Special Orders.

* Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE CUSTOMER SIGNATURE



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 85398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 01/22/2024 5:00 PM

Cashiered 04/09/2024 2:34 PM

Printed 04/09/2024 2:35:04 PM

PO #

Service Invoice

Page 4

Tag

SO # 809338

Customer No

Attn:
EDMONTON TRAILER SALES GP
10602-82 AVENUE
CLAIRMONT, AB T8X 5G9
GST: NoTaxNumber

Home Bus (780) 830-3063
Cell Today
Email

Advisor Taylor

Invoice Date: 04/09/2024 2:34 PM Term CASH

License No	Odometer In	Odometer Out	Delivery Date	Stock No
	1	1		14948A
Year	Make	Model	Model No	Colour
2015	EXOSENT	EXO LPG - SUPER B		
Vehicle ID No	Selling Dealer	SO Date	InServ Date	Location
1E9X6SB21FC519105		01/22/2024		
Engine Size	Fleet #	PIC/AD		

Request	Description
CVIP-	COMMERCIAL VEHICLE INSPECTION 14948B
Labour	Description
CVIP-	<ul style="list-style-type: none">- Perform Commercial Vehicle Inspection- Record deficiencies- Fill out appropriate paperwork- Decal unit - CV7623044

Job	CSR	Status
3 KAYLEIGH		Approved
Type	Tech	Amount
I-ADV GP TECH		300.00

Labour Total	300.00
Request Total	300.00

Request	Description
CVIP	REPAIRS FOR CVIP
Labour	Description
CVIP	<ul style="list-style-type: none">- Sniff unit = safe- Remove rear hatch- Take off caps from plumbing- Bring unit inside- Sniff unit after warmed up = safe- Put unit on axle stands and remove wheels- Remove and replace axle #1 L/H & R/H shocks- Remove and rebuild axle #1 L/H & R/H calipers- Remove and rebuild axle #2 R/H caliper- Remove and replace axle #2 L/H caliper- Remove and replace axle #2 L/H & R/H rotors- Remove and replace axle #2 L/H brake pads- Remove and replace axle #2 L/H & R/H wheel seals- Remove and replace axle #2 L/H & R/H hubcap gaskets- Diagnose and repair air leak on service line- Diagnose Abs issue- Remove and replace Axle #1 L/H & R/H Abs wheel speed sensors- Remove and replace damaged abs extension line- Remove and replace license plate light and pig tail- Install missing reflectors- Remove and replace rear tail light- Re-install wheels- Remove and replace axle #1 L/H tiremaxx air line- Grease unit- Remove axle stands- Torque wheels and tag- Set up brakes- Remove and replace damaged rear hatch bolts and nuts

Job	CSR	Status
4 KAYLEIGH		Approved
Type	Tech	Amount
I-ADV GP TECH		2,100.00

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

* No Refunds or Exchange on Parts after 30 days.

* No Refunds or Exchange on Electrical Items or Special Orders.

* Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 89398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 01/22/2024 5:00 PM

Cashiered 04/09/2024 2:34 PM

Printed 04/09/2024 2:35:04 PM

PO #

Service Invoice

Page 5

Tag

INTERNAL COPY

SO # 809338

Customer No		Advisor Taylor		Invoice Date: 04/09/2024 2:34 PM		Term CASH	
Attn:		License No		Odometer In		Odometer Out	
EDMONTON TRAILER SALES GP		1		1		Delivery Date	
10602-82 AVENUE		Year		Make		Model	
CLAIRMONT, AB T8X 5G9		2015		EXOSANT		EXO LPG - SUPER B	
GST: NoTaxNumber		Model No		Stock No		Colour	
Home		Bus		Vehicle ID No		Selling Dealer	
(780) 830-3063		Today		1E9X6SB21FC519105		SO Date	
Cell						InServ Date	
						Location	
Email				Engine Size		Fleet #	
						PIC/AD	

- Install rear tank hatch
- Move unit out of bay
- Clean bay

Part	Description	Shp	Bin	Type	Price	Amount
IMT-6402259212	REPAIR KIT, WABCO PAN 22	3	I4	I-ADV	138.06	414.18
VS337692	AUTO AIR LINE 90	1	H2	I-ADV	41.06	41.06
S33649-2	AIR DISK ATTACHMENT HARDWARE	3	I3	I-ADV	22.90	68.70
3303118	GASKET - Hubcap	2	G END	I-ADV	1.71	3.42
3727099	WHEEL SEAL - 2023 (307-0723)	2	I1	I-ADV	51.35	102.70
75W90 GEAR OIL	OIL - Gear, Synthetic, 75W90	4	SHOP	I-ADV	11.69	46.76
34X212	BOLT - 3/4" x 2-1/2"	1	BIN 2G	I-ADV	0.85	0.85
85000	SHOCKS - Fleetline 1-5/8 Bore (66893 MONROE)	2	I6	I-ADV	53.99	107.98
14624	UNION, 1/4	1	BIN 3A	I-ADV	1.75	1.75
R955337	ABS SENSOR - (Hyd), 1.8m	1	A5	I-ADV	69.00	69.00
NPN	87868 ROTOR, AIR DISC, PANN 22 SSR948	2	1SO	I-NPN	331.19	662.38
SSP1777	AIR DISC PADS, WABCO PAN22	1	1SO	I-ADV	141.11	141.11
6402250800	CALIPER DISC BRAKE	1	1SO	I-ADV	1,114.24	1,114.24
S33649-2	AIR DISK ATTACHMENT HARDWARE	1	I3	I-ADV	44.16	44.16
R955337	ABS SENSOR - (Hyd), 1.8m	1	A5	I-ADV	69.00	69.00
R955338	ABS SENSOR - Straight, 1.8m	1	A5	I-ADV	50.60	50.60
126-9122	2 WIRE PIGTAIL	2	R2	I-ADV	0.81	1.62
15200C	LICENSE PLATE LIGHT	1	R3	I-ADV	2.39	2.39
4050	LIGHT - 4" Red LED, Round	1	R2	I-ADV	21.91	21.91
41002	Reflector Red 2", Stick-On	2	R3	I-ADV	1.27	2.54
NPN	87894 7" OD SS GEAR CLAMP PHAS-104	2	1SO	I-NPN	5.09	10.18
STU 58X312 B7M	5/8X3-1/2 B7M STUD	36	BIN 5C	I-ADV	2.09	75.24
STU 58 2HM	5/8 2HM NUT	48	BIN 5C	I-ADV	1.64	78.72
Parts Total						3,130.49
Labour Total						2,100.00
Request Total						5,230.49

Request	Description	Job	CSR	Status
REPAIR	FLARE UNIT - 14948A	5	TAYLOR	Approved
Labour	Description	Type	Tech	Amount
REPAIR	- Move unit to flare stack	I-ADV	GP TECH	280.00
	- Remove all caps			

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

* No Refunds or Exchange on Parts after 30 days.

* No Refunds or Exchange on Electrical Items or Special Orders.

* Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 89398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 01/22/2024 5:00 PM

Cashiered 04/09/2024 2:34 PM

Printed 04/09/2024 2:35:04 PM

PO #

Service Invoice INTERNAL COPY

Page 6

Tag

SO # 809338

Customer No Attn: EDMONTON TRAILER SALES GP 10602-82 AVENUE CLAIRMONT, AB T8X 5G9 GST: NoTaxNumber Home (780) 830-3063 Cell Today Email	Advisor Taylor Invoice Date: 04/09/2024 2:34 PM Term CASH <table><tr><td>License No</td><td>Odometer In</td><td>Odometer Out</td><td>Delivery Date</td><td>Stock No</td></tr><tr><td></td><td>1</td><td>1</td><td></td><td>14948A</td></tr><tr><td>Year</td><td>Make</td><td>Model</td><td>Model No</td><td>Colour</td></tr><tr><td>2015</td><td>EXOSENT</td><td>EXO LPG - SUPER B</td><td></td><td></td></tr><tr><td>Vehicle ID No</td><td>Selling Dealer</td><td>SO Date</td><td>InServ Date</td><td>Location</td></tr><tr><td>1E9X6SB21FC519105</td><td></td><td>01/22/2024</td><td></td><td></td></tr><tr><td>Engine Size</td><td></td><td>Fleet #</td><td>PIC/AD</td><td></td></tr></table>	License No	Odometer In	Odometer Out	Delivery Date	Stock No		1	1		14948A	Year	Make	Model	Model No	Colour	2015	EXOSENT	EXO LPG - SUPER B			Vehicle ID No	Selling Dealer	SO Date	InServ Date	Location	1E9X6SB21FC519105		01/22/2024			Engine Size		Fleet #	PIC/AD	
License No	Odometer In	Odometer Out	Delivery Date	Stock No																																
	1	1		14948A																																
Year	Make	Model	Model No	Colour																																
2015	EXOSENT	EXO LPG - SUPER B																																		
Vehicle ID No	Selling Dealer	SO Date	InServ Date	Location																																
1E9X6SB21FC519105		01/22/2024																																		
Engine Size		Fleet #	PIC/AD																																	

- Hook up flare stack to unit
- Open valve and light flare stack
- Monitor flair until stabilized
- Check on unit periodically until unit is completely flared
- Remove flare stack from unit

Labour Total 280.00

Request Total 280.00

Request	Description	Job	CSR	Status
REPAIR	FLARE UNIT - 14948B	6	TAYLOR	Approved
Labour	Description	Type	Tech	Amount
REPAIR	- Move unit to flare stack	I-ADV	GP TECH	280.00
	- Remove all caps			
	- Hook up flare stack to unit			
	- Open valve and light flare stack			
	- Monitor flair until stabilized			
	- Check on unit periodically until unit is completely flared			
	- Remove flare stack from unit			

Labour Total 280.00

Request Total 280.00

- PLEASE NOTE THAT ALL WHEEL END COMPONENTS WERE SEIZED AND COVER WILL UNDER COATING

- ABS ISSUES VERY DIFFICULT TO DETERMINE

Summary

Pay Type	Labour	Parts	Fees	Misc	Supplies	Sublet	Env	Ded	GST	Total
C	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
W	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
I	7,460.00	14,192.56	0.00	0.00	0.00	729.23	0.00	0.00	0.00	22,381.79
Total	7,460.00	14,192.56	0.00	0.00	0.00	729.23	0.00	0.00	0.00	22,381.79

INTERNAL

ACCOUNT	DESCRIPTION	TYPE	CONTROL #	AMOUNT	COMMENTS
66000	Trailer Rental Expense		14948A	22381.79	519105 - 2015 EXOSENT EXO LPG - SUPER B LEAD

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

* No Refunds or Exchange on Parts after 30 days.

* No Refunds or Exchange on Electrical Items or Special Orders.

* Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 89398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 03/15/2023 5:00 PM

Cashiered

04/02/2023 12:00 PM

Printed

04/09/2024 11:34:33 AM

PO #

Service Invoice

Page 1

Tag

INTERNAL COPY - REPRINT

SO # 808824

Customer No	Advisor SASHA	Invoice Date: 04/02/2023 12:00 PM Term CASH		
Attn:	License No	Odometer In	Odometer Out	Delivery Date
EDMONTON TRAILER SALES GP		1	1	
10602-82 AVENUE	Year	Make	Model	Stock No
CLAIRMONT, AB T8X 5G9	2015	EXOSENT	EXO LPG - SUPER B	14948A
GST: NoTaxNumber	Vehicle ID No	Selling Dealer	Model No	Colour
Home	1E9X6SB21FC519105		SO Date	InServ Date
Bus (780) 830-3063	Engine Size		03/15/2023	Location
Cell			Fleet #	PIC/AD
Email				

Request	Description	Job	CSR	Status
REPAIR	INTERNAL VALVE ISSUES (LEAD)	1	SASHA	Original
Labour	Description	Type	Tech	Amount
REPAIR	- Diagnose internal valve Internal valve slamming shut intermittently	I-ADV	GP TECH	1,400.00
	- De pressure vessel and remove hatch			
	- Found mesh screen 1/2 plugged of with sludge and rust build up			
	- Remove screen Extra time needed to remove screen due to rust build up			
	- Remove internal parts			
	- Found actuator arm pin had fallen out and arm was partially out of place			
	- Re-install actuator arm with new cotter pin to secure into place			
	- Clean all internal parts			
	- Install repair kit for worn parts			
	- Re-install all parts			
	- Cleaned rust/sludge scale from inside of tank			
	- Re-install hatch			

Part	Description	Shp	Bin	Type	Price	Amount
107507	NITROGEN MCP16 HT, 16 CYL BULK PACK	1	YARD	I-ADV	816.34	816.34
STU 58 2HM	NUT - 5/8 2HM (15.88mm)	5	BIN 5C	I-ADV	1.64	8.20
T11396000B2	C404 PACKING REPAIR KIT	1	M2	I-ADV	91.31	91.31
Parts Total						915.85
Labour Total						1,400.00
Request Total						2,315.85

Request	Description				Job	CSR	Status
REPAIR	REMOVE/REPLACE DIVETER VALVE (LEAD)				2	JASONR	Approved
Labour	Description				Type	Tech	Amount
REPAIR	- Remove and replace hydraulic diverter valve				I-ADV	GP TECH	140.00
	- Test operations for repairs = Good at time of test						
Part	Description	Shp	Bin	Type	Price	Amount	
8252785	FLOW CONTROL, PRESSURE COMP, 30GPM	1	SPECORD	I-ADV	137.99	137.99	
Parts Total						137.99	
Labour Total						140.00	
Request Total						277.99	

Request	Description	Job	CSR	Status
REPAIR	ROCHESTOR GAUGE STICKY (LEAD)	3	JASONR	Approved
Labour	Description	Type	Tech	Amount
REPAIR	- Diagnose Rochester gauge	I-ADV	GP TECH	87.50

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

• No Refunds or Exchange on Parts after 30 days.

• No Refunds or Exchange on Electrical Items or Special Orders.

• Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 89398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 03/15/2023 5:00 PM

Cashiered 04/02/2023 12:00 PM

Printed 04/09/2024 11:34:33 AM

PO #

Service Invoice

Page 2

Tag

INTERNAL COPY - REPRINT

SO # 808824

Customer No		Advisor SASHA		Invoice Date: 04/02/2023 12:00 PM		Term CASH	
Attn:		License No		Odometer In		Odometer Out	
EDMONTON TRAILER SALES GP		1		1		Delivery Date	
10602-82 AVENUE						Stock No	
CLAIRMONT, AB T8X 5G9						14948A	
GST: NoTaxNumber		Year		Make		Model	
		2015		EXOSENT		EXO LPG - SUPER B	
Home		Bus		Model No		Colour	
(780) 830-3063		Today					
Cell		Vehicle ID No		Selling Dealer		SO Date	
		1E9X6SB21FC519105				03/15/2023	
Email		Engine Size		Fleet #		PIC/AD	

- Climb into tank and operate float system up and down
- Rochester guage reading fine

Labour Total 87.50
Request Total 87.50

Request	Description	Job	CSR	Status
REPAIR	REMOVE/REPLACE RAILWAY DECAL (PUP)	4	JASONR	Approved
Labour	Description	Type	Tech	Amount
REPAIR	- Remove and replace rail road crossing decal	I-ADV	GP TECH	297.50
Part	Description	Shp	Bin	Type
BP010	RAILROAD CROSSING	1	DISPLAY	I-ADV
				Price
				47.76
				Amount
				47.76
				Parts Total
				47.76
				Labour Total
				297.50
				Request Total
				345.26

Request	Description	Job	CSR	Status
REPAIR	LIQUID DISCHARGE VALVE LEAKS (PUP)	5	JASONR	Approved
Labour	Description	Type	Tech	Amount
REPAIR	- Remove and replace R/H #2 liquid ball valve	I-ADV	GP TECH	280.00
	- Test for repair = Good at time of test			
Part	Description	Shp	Bin	Type
EMI 730-01-08	BALL VALVE - 2" SS, Full Port	1	E3	I-ADV
107507	NITROGEN MCP16 HT, 16 CYL BULK PACK	1	YARD	I-ADV
				Price
				238.96
				Amount
				238.96
				Parts Total
				907.11
				Labour Total
				280.00
				Request Total
				1,187.11

Request	Description	Job	CSR	Status
REPAIR	REMOVE AND REPLACE DIVERTER VALVE (PUP)	6	SASHA	Approved
Labour	Description	Type	Tech	Amount
REPAIR	- Remove and replace hydraulic diverter valve	I-ADV	GP TECH	210.00
	- Test operations for repairs = Good at time of test			
	- Install broken flipper Valve			
Part	Description	Shp	Bin	Type
8252785	FLOW CONTROL, PRESSURE COMP, 30GPM	1	SPECORD	I-ADV
TBF229635	VALVE - Flipper	1	A1	I-ADV
XX86-50	RIVETS - 1/4 X 3/8 S/S	6	BIN 1B	I-ADV
				Price
				137.99
				Amount
				137.99
				14.23
				14.23
				1.13
				6.78

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

- No Refunds or Exchange on Parts after 30 days.
- No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$_____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____



ETS GRANDE PRAIRIE

10602-82 Avenue Clairmont, Alberta T0H 0W0
Phone 780.830.3063 | Toll Free 1.877.962.8195
Fax 780.830.3089 | www.edmontontrailer.com

INVOICE

GST # 89398 4799 RT0001

A Division of EDMONTON TRAILER SALES & LEASING LTD.

Promised 03/15/2023 5:00 PM

Cashiered 04/02/2023 12:00 PM

Printed 04/09/2024 11:34:33 AM

PO #

Service Invoice

INTERNAL COPY - REPRINT

Page 3

Tag

SO # 808824

Customer No		Advisor SASHA				Invoice Date: 04/02/2023 12:00 PM				Term CASH	
Attn:											
EDMONTON TRAILER SALES GP											
10602-82 AVENUE											
CLAIRMONT, AB T8X 5G9											
GST: NoTaxNumber											
Home	Bus	(780) 830-3063									
Cell	Today										
Email											
License No	Odometer In	Odometer Out	Delivery Date	Stock No							
	1	1		14948A							
Year	Make	Model	Model No	Colour							
2015	EXOSSENT	EXO LPG - SUPER B									
Vehicle ID No	Selling Dealer	SO Date	InServ Date	Location							
1E9X6SB21FC519105		03/15/2023									
Engine Size		Fleet #	PIC/AD								

Parts Total 159.00
Labour Total 210.00
Request Total 369.00

Request	Description	Job	CSR	Status
REPAIR	TIRE REPLACEMENT	7	SASHA	Approved
Labour	Description	Type	Tech	Amount
REPAIR	- Remove and replace Tires	I-ADV	GP TECH	35.00
Sublet	Description	Type	CSR	Amount
	86948 FIELD SERVICE - APPOINTMENT	ISUB-ADV	TAYLOR	19,002.30
Labour Total				19,037.30
Request Total				19,037.30

Request	Description	Job	CSR	Status
REPAIR	FLARE LEAD UNIT	8	JASONR	Approved
Labour	Description	Type	Tech	Amount
REPAIR	FLARE LEAD UNIT	I-ADV	GP TECH	280.00
Labour Total				280.00
Request Total				280.00

Summary	Pay Type	Labour	Parts	Fees	Misc	Supplies	Sublet	Env	Ded	GST	Total
C		0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
W		0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
I		2,730.00	2,167.71	0.00	0.00	0.00	19,002.30	0.00	0.00	0.00	23,900.01
Total		2,730.00	2,167.71	0.00	0.00	0.00	19,002.30	0.00	0.00	0.00	23,900.01

INTERNAL

ACCOUNT	DESCRIPTION	TYPE	CONTROL #	AMOUNT	COMMENTS
66000	Trailer Rental Expense		14948A	23900.01	519105 - 2015 EXOSSENT EXO LPG - SUPER B LEAD

Remit Payment To: Edmonton Trailer Sales & Leasing LTD | 28520 - 114 Avenue, Acheson, AB, T7X 6E6

- No Refunds or Exchange on Parts after 30 days.
- No Refunds or Exchange on Electrical Items or Special Orders.
- Parts Returned for Credit that have been Supplied as Ordered are Subject to a 25% Handling Charge

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$_____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE, NET 30 DAYS, INTEREST OF 2% PER MONTH (24% PER ANNUM) CHARGED ON ALL OVERDUE ACCOUNTS.

DATE _____ CUSTOMER SIGNATURE _____