



**Commercial Vehicle Inspection Certificate
Traffic Safety Act**

**PART 1 - VEHICLE OWNER AND VEHICLE
IDENTIFICATION**

Vehicle Type:	Truck	Seating Capacity:	
GVW:	24766 kg	Brake Type:	Air
Owner Name:	Twin City Excavating Inc.		
Address:	25846 115 Avenue		
City:	Acheson	Province:	AB
		Postal Code:	T7X6C5
Telephone Number:	(780) 447-4737		
Vehicle Identification Number:	2FZHCHDC76AV51510		
Make:	Sterling	Model:	Sterling
Year:	2006	Unit Number:	136
Odometer:	204041 KM	Licence Plate Number:	32M117
		Province:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	World Gear & Truck Repair Ltd.	Facility Number:	14812
Inspection Technician Name:	Yussef Tarrabain	Technician Number:	A2959
Inspection Technician Signature:			
Inspection Date:	2019/03/07		

2)
C

)

)

**COMMERCIAL VEHICLE RECORD OF INSPECTION
TRUCK AND TRUCK-TRACTOR**

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle Truck										Gross Vehicle Weight registered 24766 kg											
Vehicle Information																					
VIN 2 F Z H C H D C 7 6 A V 5 1 5 1 0		Unit Number 136				Year 2006				Make Sterling				Model Sterling				Odometer 204,041			
Registered Owner's Name Twin City Excavating Inc.															Plate Number 32M117						
Address 25846 115 Avenue										Postal Code T7X6C5					Phone Number (780) 447-4737						
Drum Brakes: A-Full Inspection with Drum Removed										Disc Brakes:											

		LEFT		FRONT		RIGHT			
105 psi	16 in	16.562 in	5/8 in	Drums/Rotors	16.572 in	5/8 in	1/2 in	105 psi	17 in
105 psi	15 in	16.500 in	3/4 in	Linings/Pads	16.500 in	3/4 in	1 1/4 in	105 psi	16 in
105 psi	12 in	16.555 in	7/16 in	Push Rod Travel	16.555 in	7/16 in	1 1/4 in	105 psi	16 in
105 psi	12 in	16.555 in	1 1/2 in	Drums/Rotors	16.555 in	7/16 in	1 1/4 in	105 psi	9 in
psi	in	in	in	Linings/Pads	in	in	in	psi	in
psi	in	in	in	Push Rod Travel	in	in	in	psi	in
psi	in	in	in	Drums/Rotors	in	in	in	psi	in
psi	in	in	in	Linings/Pads	in	in	in	psi	in
psi	in	in	in	Push Rod Travel	in	in	in	psi	in

Park Brake Lining Left NA in Right NA in Trans NA in
 Wheel Torque Checked Inner NA ft lbs Outer 500 ft lbs

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 1 - Power Train

Component	P	F	NA	Component	P	F	NA
1.1. Accelerator Pedal/Throttle Actuator	✓			1.8. Engine Start Safety Feature	✓		
1.2. Exhaust System	✓			1.9. Gear Position Indicator	✓		
1.3. Emission Control Systems and Devices	✓			1.10. Engine or Accessory Drive Belt	✓		
1.4. Drive Shaft	✓			1.11. Hybrid Electric Vehicle & Electric Vehicle Power Train System			✓
1.5. Clutch and Clutch Pedal			✓	1.12. Gasoline or Diesel Fuel System	✓		
1.6. Engine/Transmission Mount	✓			1.13. Pressurized or Liquefied Fuel System (LPG, CNG, & LNG) * SEE APPENDIX A*			✓
1.7. Engine/Shut Down	✓						

NOTES:
repaired exhaust

APPENDIX "A"

Component	P	F	NA	Component	P	F	NA
A.1. Liquefied Petroleum Gas (LPG or Propane) Fuel System			✓	A.3. Liquefied Natural Gas (LNG) Fuel System			✓
A.2. Compressed Natural Gas (CNG) Fuel System			✓				

NOTES:

Section 2 - Suspension

Component	P	F	NA	Component	P	F	NA
2.1. Suspension & Frame Attachments	✓			2.5. Air Suspension	✓		
2.2. Axle Attaching & Tracking Components	✓			2.6. Self-Steer and Controlled-Steer Axle	✓		
2.3. Axle & Axle Assembly	✓			2.7. Shock Absorber/Strut Assembly			
2.4. Spring & Spring Attachment	✓						

NOTES:
Repaired LR air bag pedestal

Section 3H - Hydraulic Brakes

Component	P	F	NA	Component	P	F	NA
3H.1. Hydraulic System Components			✓	3H.13. Disc Brake System Components			✓
3H.2. Brake Pedal/Actuator			✓	3H.14. Mechanical Parking Brake			✓
3H.3. Vacuum Assist (Boost) System			✓	3H.15. Spring-Applied Air-Released Parking Brake			✓
3H.4. Hydraulic Assist (Boost) System			✓	3H.16. Spring-Applied Hydraulic-Released Parking Brake			✓
3H.5. Air Assist (Boost) System			✓	3H.17. Anti-Lock Brake System (ABS)			✓
3H.6. Air-Over-Hydraulic Brake System			✓	3H.18. Stability Control System			✓
3H.11. Brake System Indicator Lamps			✓	3H.19. Brake Performance			✓
3H.12. Drum Brake System Components			✓				

NOTES:

Section 3A - Air Brakes

Component	P	F	NA	Component	P	F	NA
3A.1. Air Compressor	✓			3A.13. Air System Components	✓		
3A.2. Air Supply System	✓			3A.14. Brake Chamber	✓		
3A.4. Air Tank	✓			3A.15. Drum Brake System Components	✓		
3A.5. Air Tank Check Valves	✓			3A.16. S-Cam Drum Brake System	✓		
3A.6. Brake Pedal/Actuator	✓			3A.17. Brake Shoe Travel (Wedge Brakes)			✓
3A.7. Treadle Valve and Trailer Hand Valve	✓			3A.18. Disc Brake System Components		✓	
3A.8. Brake Valves & Controls	✓			3A.19. Anti-Lock Brake System (ABS)			✓
3A.9. Proportioning, Inversion or Modulation Valve	✓			3A.21. Stability Control System		✓	
3A.10. Towing Vehicle (Tractor) Protection System			✓	3A.23. Brake Performance		✓	

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 3A - Air Brakes

Component	P	F	NA	Component	P	F	NA
3A.11. Parking Brake & Emergency Application	✓						

NOTES:

Replaced both FD brakes

Section 4 - Steering

Component	P	F	NA	Component	P	F	NA
4.1. Steering Control and Linkage	✓			4.4. Kingpin	✓		
4.2. Power Steering System (Hydraulic and Electric)	✓			4.5. Self-Steer and Controlled-Steer Axle			✓
4.3. Steering Operation (Active Steer Axle)	✓						

NOTES:

Section 5 - Instruments and Auxiliary Equipment

Component	P	F	NA	Component	P	F	NA
5.1. Fire Extinguisher	✓			5.8. Heater & Windshield Defroster	✓		
5.2. Hazard Warning Kit	✓			5.9. Fuel-Burning Auxiliary Heater			
5.3. Horn	✓			5.10. Chain/"Headache" Rack			✓
5.5. Speedometer	✓			5.11. Auxiliary Controls and Devices			✓
5.6. Odometer	✓			5.12. Auxiliary Drive Controls			✓
5.7. Windshield Wiper/Washer	✓						

NOTES:

Section 6 - Lamps

Component	P	F	NA	Component	P	F	NA
6.1. Required Lamps	✓			6.4. Instrument Panel Lamps	✓		
6.2. Reflex Reflector	✓			6.5. Headlamp Aim	✓		
6.3. Retro-Reflective Marking	✓						

NOTES:

Replaced all malfunctioning lights

Section 7 - Electrical System

Component	P	F	NA	Component	P	F	NA
7.1. Wiring	✓			7.3. Trailer Cord (output to towed vehicle)			✓
7.2. Battery	✓						

NOTES:

Section 8 - Body

Component	P	F	NA	Component	P	F	NA
8.1. Hood or Engine Enclosure	✓			8.12. Bumper	✓		
8.2. Tilt Cab			✓	8.13. Windshield	✓		
8.3. Air-Suspended Cab	✓			8.14. Side Windows	✓		
8.4. Cab and Passenger-Vehicle Body	✓			8.15. Rear Window	✓		
8.5. Cargo Body	✓			8.16. Interior Sun Visor	✓		
8.6. Frame, Rails & Mounts	✓			8.17. Exterior Windshield Sun Visor	✓		
8.7. Utilized Body Elements	✓			8.18. Rear-View Mirror	✓		
8.8. Cab or Cargo Door	✓			8.19. Seat	✓		
8.9. Cargo Tank or Vessel	✓			8.20. Seat Belt/Occupant Restraint	✓		
8.10. Body, Device or Equipment Attached or Mounted to the	✓		✓	8.21. Fender/Mud Flap	✓		

2

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 8 - Body							
Component	P	F	NA	Component	P	F	NA
Vehicle							
8.11. Refrigeration/Heater Unit Fuel System (Reefer or Auxiliary Power Unit (APU))			✓	8.24. Aerodynamic Device & Attachment			✓

NOTES:

Section 9 - Tires and Wheels							
Component	P	F	NA	Component	P	F	NA
9.1. Tire Tread Depth	✓			9.7. Wheel/Rim (Applies to all wheel types)	✓		
9.2. Tire Tread Condition	✓			9.8. Multi-Piece Wheel/Rim			✓
9.3. Tire Sidewall & Manufacturer Markings	✓			9.9. Spoke Wheel/Demountable Rim System			✓
9.4. Tire Inflation Pressure	✓			9.10. Disc Wheel System			✓
9.5. Wheel Hub	✓			9.11. Wheel Fasteners (Nuts, Bolts and Studs)	✓		
9.6. Wheel Bearing	✓						

NOTES:

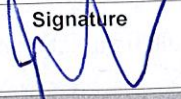
Section 10 - Couplers and Hitches							
Component	P	F	NA	Component	P	F	NA
10.1. Hitch Assembly, Structure & Attaching Components			✓	10.5. Roll-Coupling Hitch			✓
10.2. Secondary Attachment (Safety Chain or Cable)			✓	10.6. Automated Coupling Device			✓
10.3. Pintle Hook, Pin Hitch, or Coupler Hitch			✓	10.7. Fifth Wheel Coupler			✓
10.4. Ball Type Hitch			✓	10.8. Oscillating Fifth Wheel Coupler			✓

NOTES:

WO# 12358
customer did repairs

Certification

The Vehicle for which this Record of Inspection is issued has **PASSED** (Certificate #6620996) the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 211/2006 and the applicable Inspection Manual.

Date of Inspection	Technician Number	Facility Number	Signature
2019/03/07	A2959	14812	

Customer Acknowledgment

I understand if a vehicle inspection identifies defects and repairs are required, once repaired, the vehicle and this Record of Inspection (ROI) may be presented to any Vehicle Inspection Facility within 10 days of the initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.

Date (Year/Month/Day)

2019/03/07

Customer Signature